
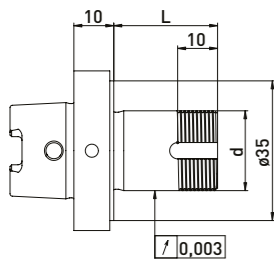


TTB HSK-F40 // Shaft $\varnothing 20$ mm // RS $\varnothing 35$ mm

For TTB tool grinding machines with ring set $\varnothing 35$ mm

GWA HSK-F40 // $\varnothing 20$ mm // RS $\varnothing 35$ mm

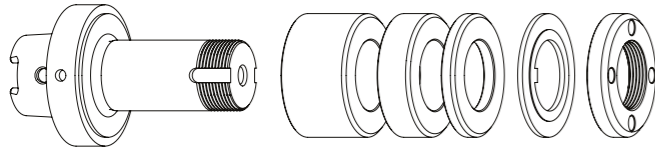

Delivered equipped:
Ring set $\varnothing 35$ mm, lock washer and clamping nut

Order No.	HSK	d	L	Ring set $\varnothing 35$ mm		
				B20	B10	B4
300132012	HSK-F40	20	26	-	-	4
300132022	HSK-F40	20	42	-	2	3
300132032	HSK-F40	20	60	1	2	3



Accessories TTB grinding wheel adapter HSK-F40 // Shaft $\varnothing 20$ mm // Ring set $\varnothing 35$ mm

Order No.	Name	Order No.	Name
350050050	Assembly device $\varnothing 40$	350012020	Spacer ring $\varnothing 35 \times \varnothing 20 \times 20$
350040010	Clamping nut wrench PC27 for $\varnothing 20$	350012010	Spacer ring $\varnothing 35 \times \varnothing 20 \times 10$
350040011	Clamping nut wrench PC27 for $\varnothing 20$	350012004	Spacer ring $\varnothing 35 \times \varnothing 20 \times 4$
350040040	*Clamping nut wrench PC29 for $\varnothing 20$ for clamping nut with blancing option	350030020	Lock washer $\varnothing 35 \times \varnothing 20 \times 2$
350040041	*Clamping nut wrench PC29 for $\varnothing 20$	350020030	Clamping nut $\varnothing 35 \times 6$ M20 x 1 PC27
350020081	*Balancing weight pair for clamping nut $\varnothing 35 // 40$ gmm	350020080	*Clamping nut with balancing option $\varnothing 35 \times \varnothing 40 \times 8$ x M20 x 1 PC29
		350015005	Support washer $\varnothing 35 \times \varnothing 60 \times \varnothing 20 \times 6$

Vollmer HSK50 // Schaft $\varnothing 20$ mm // RS $\varnothing 35$ mm

For Vollmer VGRIND tool grinding machines with ring set $\varnothing 35$ mm

GWA HSK50 // $\varnothing 20$ mm // RS $\varnothing 35$ mm

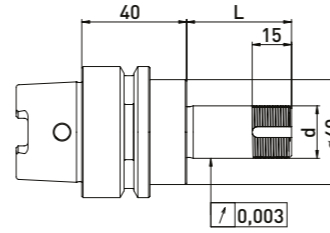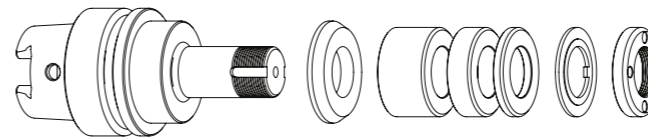

Delivered equipped:
Reducing washer, ring set $\varnothing 35$ mm, lock washer and clamping nut

Order No.	HSK	d	L	Ring set $\varnothing 35$ mm		
				B20	B10	B4
300012512	HSK50	20	40	-	1	3
300012522	HSK50	20	60	1	1	3
300012532	HSK50	20	75	1	2	4
300012542	HSK50	20	85	2	1	4
300012552	HSK50	20	100	2	3	3

Accessories Vollmer grinding wheel adapter HSK50 // $\varnothing 20$ mm // Ring set $\varnothing 35$ mm

Order No.	Name	Order No.	Name
350050010	Universal assembly device $\varnothing 50$	350012020	Spacer ring $\varnothing 35 \times \varnothing 20 \times 20$
350040010	Clamping nut wrench PC27 for $\varnothing 20$	350012010	Spacer ring $\varnothing 35 \times \varnothing 20 \times 10$
350040011	Clamping nut wrench PC27 for $\varnothing 20$	350012004	Spacer ring $\varnothing 35 \times \varnothing 20 \times 4$
350040040	*Clamping nut wrench PC29 for $\varnothing 20$ for clamping nut with blancing option	350015006	Reducing washer $\varnothing 40 \times \varnothing 35 \times \varnothing 20 \times 6$
350040041	*Clamping nut wrench PC29 for $\varnothing 20$	350030020	Lock washer $\varnothing 35 \times \varnothing 20 \times 2$
350020081	*Balancing weight pair for clamping nut $\varnothing 35 // 40$ gmm	350020030	Clamping nut $\varnothing 35 \times 6$ M20 x 1 PC27
		350020080	*Clamping nut with balancing option $\varnothing 35 \times \varnothing 40 \times 8$ x M20 x 1 PC29
		350015005	Support washer $\varnothing 35 \times \varnothing 60 \times \varnothing 20 \times 6$